

382A012 to 046


Transitions

'Y' Transition, heat shrink boots

As supplied



After Recovery

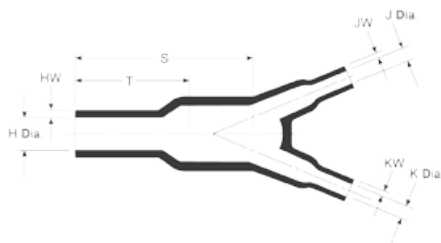

Used for mechanical protection and cable strain relief. Ideal for cable harness applications where balanced cable branches are required..

Ordering Information

- Standard colour Black.
- Size selection please refer to table below.
- Packaged individually
- Please specify the product name, size, material, coating and any modifications required, as per Part Number System earlier in this section.
- Adhesive coating is optional. If added the entry dimensions will be reduced by 1.5mm.

Part Number Example:

382A034-4-0

Moulded part in flexible polyolefin, colour black.

Product Dimensions Selection Table

Dimension	Dimensions as Supplied		Dimensions After Recovery							Weight
	H	J, K	H	J,K	S ±10%	T ±10%	HW ±20%	JW & KW ±20%		
Part Number										
382A012	13.2	6.6	6.1	3.3	23.9	15.5	1.52	1.02	1.7g	
382A023	26.9	13.2	12.4	6.1	53.3	33.0	2.54	1.52	13.6g	
382A034	38.6	26.9	18.0	12.4	78.7	55.9	3.05	2.54	55.5g	
382A046	55.6	26.9	25.9	12.7	111.8	71.1	4.57	2.54	93.4g	

All dimensions in mm unless otherwise stated. Weight is based on polyolefin part

Optional 'Injection' (S) and 'Vent' (T) ports indicated above, see part number system earlier in this section.

Materials Available

Material	Material Description
-3	Semi-rigid polyolefin
-4	Flexible polyolefin
-12	Fluoro-elastomer
-25	Fluid resistant elastomer
-100	Polyolefin, Zerohal

Environmental Adhesives Available

Optional Pre-coat	Optional User Applied
/42 or /86	S-1017 or S-1048
/42 or /86	S-1017 or S-1048
N/A	S-1255-04
/42 or /86 or /225	S-1017 or S-1048 or S-1125
/86 or /180	S-1048 or S-1030

For more information on materials and adhesives, please refer to relevant sections of this catalogue.